




AccuLoad III-S Unit

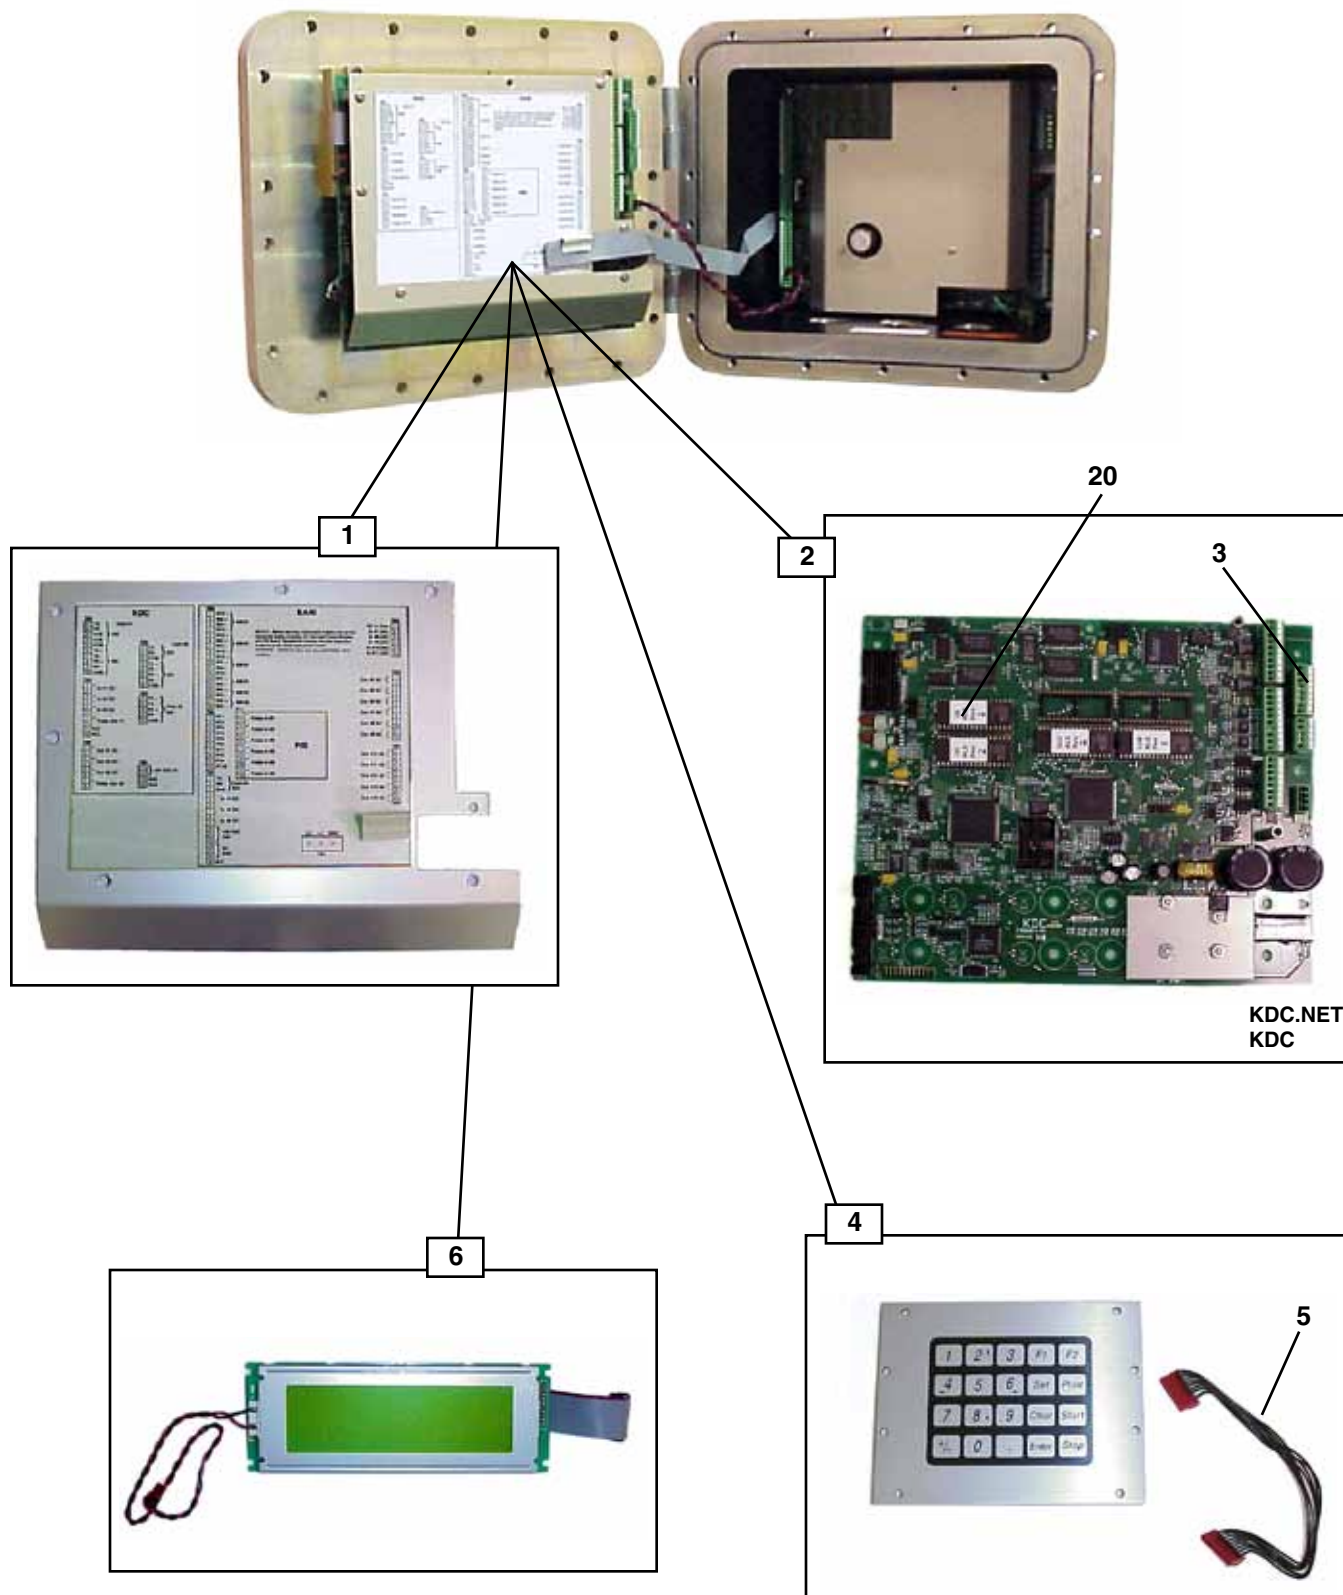

AccuLoad III-S Unit

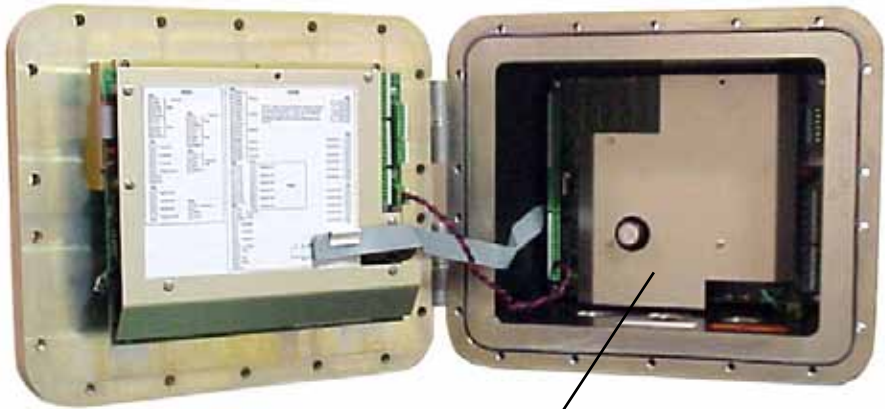

7

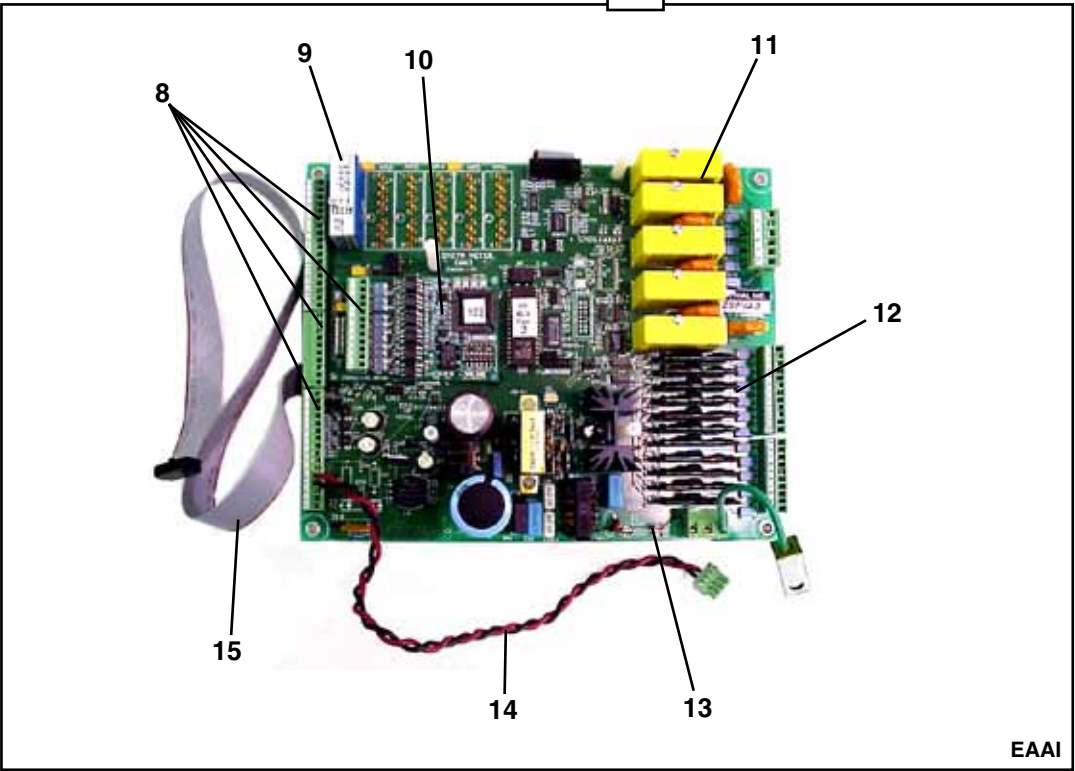

EAAI

21




SDI

Optional Boards

AICB

16

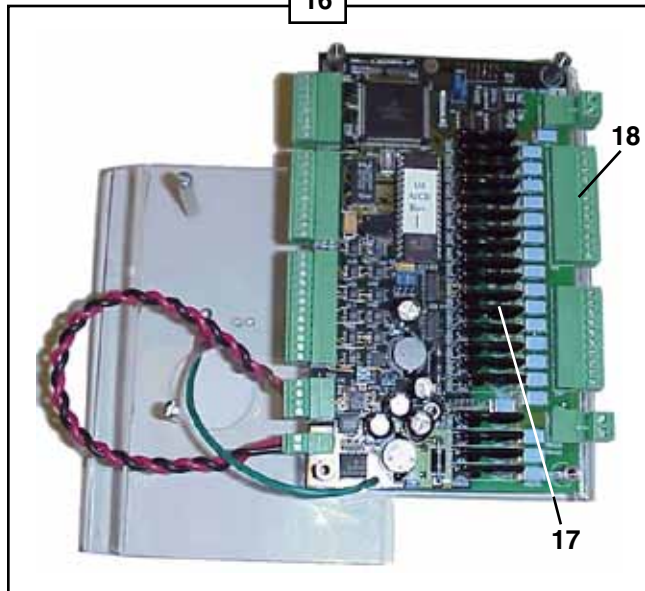

19



<u>Item</u>	<u>Description</u>	<u>Qty.</u>	<u>Part Number</u>
1	Legend Panel.....	1	554453-001
2	Board, Assembly, Computer	1	
R@1	KDC		236060-150-001
	KDC.net w/ALX1 Firmware.....		236060-152-ELX1
	KDC.net w/ALX2 Firmware		236060-152-ELX2
3	Connector Kit KDC/KDC.net.....	1	236066-101
4	Keypad.....	1	235964-102
5	Keypad Cable	1	236031-105
6	Display w/5-inch Ribbon Cable	1	236068-101
7	@2 Board, Assembly, EAAI.....	1	236046-150-001
8	Connector Kit EAAI.....	1	236052-101
9	Analog Modules:		
	RTD	#	235562-101
	4-20 mA In	#	235553-101
	4-20 mA Out	#	235565-101
	1-5 Vdc In	#	235559-101
	1-5 Vdc Out.....	#	235568-101
10	PIB Board	2	236062-101
11	AC Inputs	9	644695-410
12	AC Outputs	27	644695-419
13	EAAI Fuse.....	1	644588-473
14	24 Vdc Power Cable Assembly w/o Connectors	1	236069-101
15	Ribbon Cable	1	236031-104
16	AICB Board (Optional)	1	236087-101-001
17	AC Outputs	20	644695-420
18	AICB Connector Kit.....	1	236091-101
19	PROM Puller	1	644880-402
20	** Display Firmware (U5 & U6) (KDC only).....	1	554414-022
21	SDI (Memory Expansion).....	1	236141-101
22	* "ALX1" Firmware Kit for Non- .net ALIII	1	554414-017-LX1
23	* "ALX2" Firmware Kit for Non- .net ALIII	1	554414-017-LX2
24	* "ALP1" Firmware Kit for Non- .net ALIII	1	554414-027-LP1
25	* "ALP2" Firmware Kit for Non- .net ALIII	1	554414-027-LP2
26	* Cover Bolt M8 - 1.25 x 35 mm	16	644824-405
27	* Cover Bolt M8 - 1.25 x 60 mm w/Seal Hole	2	550227-002

<u>Item</u>	<u>Description</u>	<u>Qty.</u>	<u>Part Number</u>
R	Indicates change since last revision		
@1	Replacement KDC and EAAI board are supplied without firmware.		
@2	Replacement EAAI is shipped without the PIB and AC Inputs and Outputs. The firmware, PIB and AC Inputs and Outputs are to be taken off the respective defective board and reinstalled on the new board in the field.		
**	Required for all units with Rev. B displays and KDC's with firmware prior to 10.13. Included in KDC firmware kits when complete kit is ordered.		
*	Not illustrated.		
#	Order quantity required.		

Revisions included in P0401.06 Issue/Rev. 0.6 (3/11):
Removed KDC.net ALX3 through KDC.net ALX6 Firmware.

The specifications contained herein are subject to change without notice and any user of said specifications should verify from the manufacturer that the specifications are currently in effect. Otherwise, the manufacturer assumes no responsibility for the use of specifications which may have been changed and are no longer in effect.

Contact information is subject to change. For the most current contact information, visit our website at www.fmctechnologies.com/measurementsolutions and click on the "Contact Us" link in the left-hand column.

Headquarters:

500 North Sam Houston Parkway West, Suite 100, Houston, TX 77067 USA, Phone: +1 (281) 260 2190, Fax: +1 (281) 260 2191

Measurement Products and Equipment:

Erie, PA USA +1 (814) 898 5000

Ellerbek, Germany +49 (4101) 3040

Barcelona, Spain +34 (93) 201 0989

Beijing, China +86 (10) 6500 2251

Buenos Aires, Argentina +54 (11) 4312 4736

Burnham, England +44 (1628) 603205

Dubai, United Arab Emirates +971 (4) 883 0303

Los Angeles, CA USA +1 (310) 328 1236

Melbourne, Australia +61 (3) 9807 2818

Moscow, Russia +7 (495) 5648705

Singapore, +65 6861 3011

Thetford, England +44 (1842) 822900

Integrated Measurement Systems:

Corpus Christi, TX USA +1 (361) 289 3400

Kongsberg, Norway +47 (32) 286700

Dubai, United Arab Emirates +971 (4) 883 0303

Visit our website at www.fmctechnologies.com/measurementsolutions